


MBRP

139Q204/1390109

2021-2025 SKI-DOO 600 EFI MXZ / RENEGADE / BACKCOUNTRY / NEO / NEO + 2021 SKI-DOO EXPEDITION SPORT

Note: Local regulations may limit or prohibit modification to your snowmobile's emissions system and/or the sound levels that it generates. It is your responsibility to be aware of restrictions that may apply to your intended use of this product.

1. Remove both side panels and belt guard.
2. Loosen the clamp sealing the airbox to the hood and disconnect. It is located just above the secondary clutch.
3. Remove the windshield if applicable and the 2 screws securing the gauge pod to the hood. Lift the gauge pod and remove the storage bin.
4. Unplug the headlight connectors and intake air sensor. Gauge pod can now be pulled back out of the way.
5. Remove the 4 screws (2 under the gauge cluster, 2 behind the side panels) securing the hood assembly and slide it forward approx. 3" to disengage the locking tabs located at the front of the hood and at the gas tank. Lift the assembly off.
6. Remove the exhaust springs from the muffler inlet.
7. Remove the muffler retaining bolt and spring. Remove the exhaust sensor from the muffler.
8. Remove the muffler from the sled, making sure the gasket stays on the outlet of the expansion chamber. Remove the 3 rubber bushings from the muffler as they will be reused.
9. Insert rubber bushings on the **MBRP muffler**, only 2 will be used. Be sure the bushing with the metal sleeve is installed in the upper bracket.
10. Install the **MBRP muffler** in the sled. Reinstall the exhaust sensor and the muffler retaining bolt and spring.
11. Reinstall the exhaust springs.
12. Reinstall the hood, gauge pod, storage bin, windshield, belt guard and side panels in the reverse order.

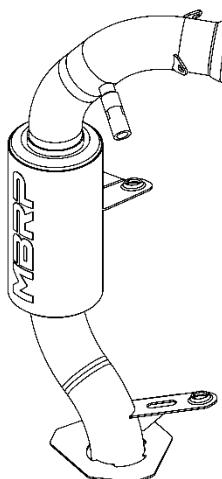

MBRP Ltd. warranty applies for a two (2) year period from the date of purchase to defects in product material and workmanship and is to the original purchaser on record and for the original vehicle for which it was designed and installed. This warranty is limited, at MBRP Ltd.'s sole determination, to the repair or replacement of defective product only and does not include the cost of removal or re-installation, damage by accident, abuse, misuse or misapplication or any consequential damages however they may arise. Determination of warranty coverage shall be at the discretion of an authorized MBRP quality engineer.

